



	Assembly Order No.				
Style	Blind nuts, 1/4 NPT	W01-358-7001			
16	Blind nuts, 3/4 NPT	W01-358-6996			
Two Ply Bellows	Socket head aluminum bead rings (bolts, nuts, washers not included-use 1/4 cap screws)	W01-358-0017			
	3/4 NPT (only) upper plate, blind nuts lower plate	W01-358-0286			
	Rubber bellows only	W01-358-0010			
Assembly weight					
Force to collapse to minimum height (@ 0 PSIG) 30 lbs.					

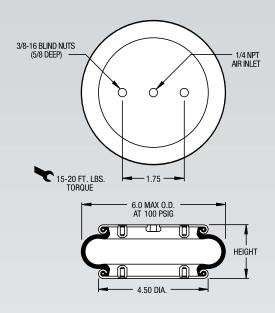

NOTE: A bead plate part is shown. This part is also available with bead rings. Bolts are not included. See pages 8-10 for explanation.

	ynamic Characteristics at 3.0 in. Design Height (Required for Airmount isolator design only)						
Volume @	2 100 PSIG :	_Natural					
Gage	Load (lbs.)	Spring Rate (lbs./in.)	Frequency				
Pressure (PSIG)			СРМ	HZ			
40	420	765	254	4.24			
60	640	1,088	244	4.07			
80	880	1,410	237	3.96			
100	1,120	1,710	232	3.86			

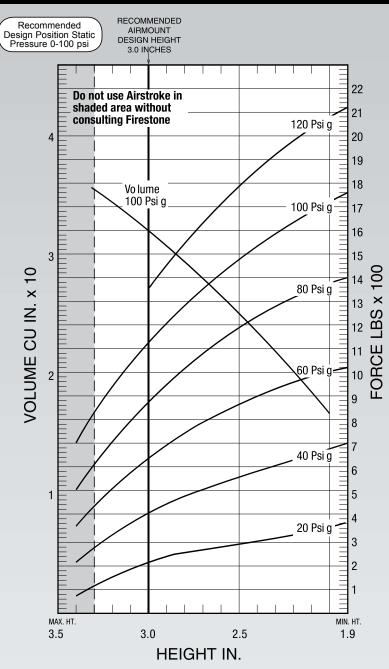

See page 12 for instructions on how to use chart.

Force Table (Use for Airstroke™ actuator design)										
Assembly Height (in.)	Volume @ 100 PSIG (in ³)	Pounds Force								
		@20 PSIG	@40 PSIG	@60 PSIG	@80 PSIG	@100 PSIG				
3.0	32	220	420	640	880	1,120				
2.0	17	350	680	1,020	1,370	1,720				